EFT



AIRCRAFT ENGINES, Inc.

CONTACT US: TOLL FREE 888-371-1371 LOCAL 918-371-3000 FAX 918-371-3041 OR LOOK US UP AT WWW.OVERHAUL.COM E-MAIL: INFO@OVERHAUL.COM

Engine Make: Lycoming


Engine Model: O-320-D1D

Serial Number: L-7824-39A

Work Order #: 909091

C&C Aviation, LLC

ENGINE MAINTENANCE RECORDS

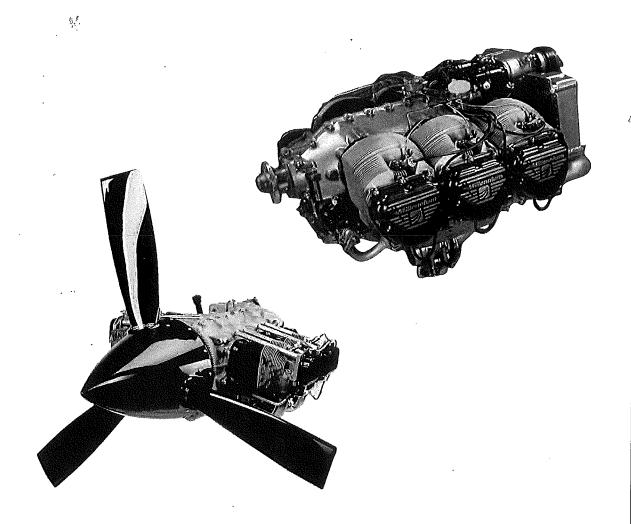



Shipping Address: 2505 W. Broadway, Collinsville, OK 74021 ■ Mailing Address: P.O. Box 582453, Tulsa, OK 74158-2453
Toll Free 888 371-1371 ■ 918 371-3000 ■ FAX 918 371-3041 ■ Look us up at www.overhaul.com ■ E-Mail: info@overhaul.com
FAA Certified Repair Station IAXR223L

ENGINE MAINTENANCE RECORDS

1

·	Log No
Aircraft Registration No. <u>N7766A</u>	_
Engine Manufacturer Lycomina	_
Model <u>O-320-11</u>	
Serial No. <u>L-7824-39A</u>	_
Date installed on aircraft Hours	_
If used on multi-engine aircraft: ☐ Right	

(All applicable information must be filled in)



DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED- SIGNATURE & CERTIFICATE NO. OF PERSON PERFOR	MING MODE
				TOTALS brought forward from previous page	
				revious page	2
	MAKE	LYCOMING		MODEL 0-320-D4D	V D-A
	SERIAL#	L-7824-39A		0.000	Q61 -
•	TIME SMOH	0.0		11/20/2009	0 1
	Amorio-I- Al			3653.6	_
, a	CCOrdance wit	aft Engines, Ind	c. certifies that	this engine has been disassembled, overhauled and tested in	_
F	Procedures and	l limits used ar	d procedures a	this engine has been disassembled, overhauled and tested in and all clearances and tolerances are within specified limits.	
				manual number 60294-7.	
Α	merica's Aircra	aft Engines Inc	cortifica the	and the second	·
, ac	ccordance with	current regulat	tions of the Fed	engine identified above was overhauled and inspected in deral Aviation Administration and is approved for return to SEE NOTES	
St	ervice. Followi	ng A.D.'s comp	lied with	SEE NOTES.	
Pe	ertinent detaile	of the over-			- 5 ₀ ,
		or the overnaul	are on file at A	america's Aircraft Engines, Inc. work order number 909091.	
		01.1	. 1	Λ	
Sig	gned	teshen	D. Fran	le .	
_	Aι	thorized Signat	ure	For America's Aircraft Engines, Inc.	
				PO Box 582453 Tulsa, OK 74158	
FO	RM AAE 101	0.7			
_		CE	RTIFIED REP	AIR STATION NO. IAXR223L	•
~					
- 1					
		7			
		Lycoming	O-320-D1D	S/N: L-7824-39A W/O# 909091 A.D. NOTES 11/20/2009	
		AD 55.00			
		M.D. 39-10-0	II/ N/A AFFEC	RIAL NUMBER. TED CYLINDER BAFFLE CLAMP NOT INSTALLED. 7 N/A AFFECTED, MALVES NOT THE INSTALLED.	
		A.D. 63-23-(A.D. 64-16-(02 AMD 39-62	TED CYLINDER BAFFLE CLAMP NOT INSTALLED. 7 N/A AFFECTED VALVES NOT INSTALLED. 7 AFFECTED ELLE DIVERSIONE	
		A.D. 66-20-0	04 AMD 39-277	7 N/A AFFECTED OH THE NOT INSTALLED.	
		A.D. 75-08-0	9 AMD 30-301	2 M/A APPROVED TO NOMBER.	
		A.D. 87-10-0	6 AMD 39-629	74 N/A BY SERIAL NUMBER. 13 N/A AFFECTED IMPELLERS NOT INSTALLED. 13 N/A AFFECTED ROCKER ARMS NOT INSTALLED. 17 N/A NO PROP GOVERN ARMS NOT INSTALLED.	
1		A.D. 92-12-()5 AMD 39-826	55 M/A APPROPRIE TO THE INSTALLED.	
		A.D. 92-11-1	1 AMD 39-858	5 N/A AFFECTED PISTON PINS NOT INSTALLED. 6 N/A AFFECTED FUEL PUMP NOT INSTALLED. 6 N/A AFFECTED BUREL PUMP NOT INSTALLED.	
		AD 07 15 1	1 AMD 39-100	85 N/A APPROVED IMPELLERS NOT INSTALLED.	
	_	23.0.77-13-1		91 N/A PREVIOUS GV GOV FINS NOT INSTALLED.	
	_	A.D. 98-02-08	8 AMD 39-1029	THE VIOULSY COMPLIED WITH.	
		A.D. 98-02-08 A.D. 98-17-11 A.D. 2004-10	I AMD 39-1071	91 N/A AFFECTED PISTON PINS NOT INSTALLED. 91 N/A PREVIOULSY COMPLIED WITH. 13 N/A AFFECTED CRANKSHAFT NOT INSTALLED. 8644 C/W INSTALLED NEW BOLT LAW AR.	
	_	A.D. 98-17-11 A.D. 2004-10- A.D. 2006-12-	I AMD 39-1071 -14 AMD 39-13 -07 AMD 39-14	AS IVA AFFECTED CRANKSHAFT NOT INSTALLED. 6644 C/W INSTALLED NEW BOLT IAW AD.	
	_	A.D. 98-17-11 A.D. 2004-10- A.D. 2006-12-	I AMD 39-1071 -14 AMD 39-13 -07 AMD 39-14	ANT REPUBLISY COMPLIED WITH. IS N/A AFFECTED CRANKSHAFT NOT INSTALLED. IS N/A AFFECTED CYLINDERS NOT INSTALLED. IS N/A AFFECTED CYLINDERS NOT INSTALLED. IS N/A AFFECTED CYLINDERS NOT INSTALLED.	
	_	A.D. 98-02-08 A.D. 98-17-11 A.D. 2004-10 A.D. 2008-12 A.D. 2008-19	1 AMD 39-1071 -14 AMD 39-13 -07 AMD 39-14 -05 AMD 39-15	AGE OF AFFECTED CRANKSHAFT NOT INSTALLED. 6644 C/W INSTALLED NEW BOLT IAW AD. 6632 N/A AFFECTED CYLINDERS NOT INSTALLED. 6672 AFFECTED CYLINDERS NOT INSTALLED.	
		A.D. 98-02-08 A.D. 98-17-11 A.D. 2004-10 A.D. 2008-12 A.D. 2008-19	I AMD 39-1071 -14 AMD 39-13 -07 AMD 39-14	AGE OF AFFECTED CRANKSHAFT NOT INSTALLED. 6644 C/W INSTALLED NEW BOLT IAW AD. 6632 N/A AFFECTED CYLINDERS NOT INSTALLED. 6672 AFFECTED CYLINDERS NOT INSTALLED.	
		A.D. 98-02-08 A.D. 98-17-11 A.D. 2004-10 A.D. 2008-12 A.D. 2008-19	1 AMD 39-1071 -14 AMD 39-13 -07 AMD 39-14 -05 AMD 39-15	AGE OF AFFECTED CRANKSHAFT NOT INSTALLED. 6644 C/W INSTALLED NEW BOLT IAW AD. 6632 N/A AFFECTED CYLINDERS NOT INSTALLED. 6672 AFFECTED CYLINDERS NOT INSTALLED.	
	-	A.D. 98-02-08 A.D. 98-17-11 A.D. 2004-10 A.D. 2008-12 A.D. 2008-19	1 AMD 39-1071 -14 AMD 39-13 -07 AMD 39-14 -05 AMD 39-15	AGE OF AFFECTED CRANKSHAFT NOT INSTALLED. 6644 C/W INSTALLED NEW BOLT IAW AD. 6632 N/A AFFECTED CYLINDERS NOT INSTALLED. 6672 AFFECTED CYLINDERS NOT INSTALLED.	
		A.D. 98-02-08 A.D. 98-17-11 A.D. 2004-10 A.D. 2008-12 A.D. 2008-19	1 AMD 39-1071 -14 AMD 39-13 -07 AMD 39-14 -05 AMD 39-15	AGE OF AFFECTED CRANKSHAFT NOT INSTALLED. 6644 C/W INSTALLED NEW BOLT IAW AD. 6632 N/A AFFECTED CYLINDERS NOT INSTALLED. 6672 AFFECTED CYLINDERS NOT INSTALLED.	
		A.D. 98-02-08 A.D. 98-17-11 A.D. 2004-10 A.D. 2008-12 A.D. 2008-19	1 AMD 39-107; -14 AMD 39-13 -07 AMD 39-14 -05 AMD 39-15 	AGENTA AFFECTED CRANKSHAFT NOT INSTALLED. 6644 C/W INSTALLED NEW BOLT IAW AD. 6632 N/A AFFECTED CYLINDERS NOT INSTALLED. 6672 AFFECTED CYLINDERS NOT INSTALLED. 47629769	
		A.D. 98-02-08 A.D. 98-17-11 A.D. 2004-10 A.D. 2008-12 A.D. 2008-19	1 AMD 39-107; -14 AMD 39-13 -07 AMD 39-14 -05 AMD 39-15 	AGE OF AFFECTED CRANKSHAFT NOT INSTALLED. 6644 C/W INSTALLED NEW BOLT IAW AD. 6632 N/A AFFECTED CYLINDERS NOT INSTALLED. 6672 AFFECTED CYLINDERS NOT INSTALLED.	

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF N SIGNATURE & CERTIFICATE NO.	WORK PERFORMED- OF PERSON PERFORMIN	G WORK
				TOTALS brought forward from previous	ous page	
Annu Repla ——— PHT.	nal Inspection C ace all engine L Engine was pro		ove engine and h new. Replace roshell 100 mine	- 7824 - 394 send to America's Aircraft Engines for overhaul. R all engine baffle seal. Replace all FWF oil and fuel eral oil Inspect fuel strainers and clear vents Air		
I Cert an Ar	tify that this En	gine has been in 1 and was deterr	ninad ta ba in a			
	s M. Chrestense 507385 IA	on III	m. W. (Choten II		-
				·		O
	→	AERO JA	ACKSON ,mississippi	→	- Le	f f
	6GA Lt. En	4	7-12-11	Hourmeter 520.0		
Aero	shell W100 oil.	Washed and of	l ran engine No	cted. No metal found. Serviced engine with 8 qt. bleaks noted. A Hangell		
)-)	<u> Λ</u> Ε	RO JAC	KSON	>		
N776GA		JACKSON,MISS Date 4-22-11	SISSIPPI	neter 506.0		
1 1 1	1 100 - 11 1171-	and and man a	naina Na laalea.	No metal found. Serviced engine with 8qt. noted. A Buryell		
_	Q		JACKS	ON Q		
N776GA				Hourmeter 526.6		
1 ~	1 .11. OT/			L081394. Cleaned sparkplugs.		
<u> </u>	1	<u> </u>	,			
	Q		JACKSO MISSISSIPPI	N Q		
N776GA	Dat	e 8-13-2012		Hourmeter 539.2		
a/a 11 M020	1922 Operations	al check OK		lled alternator p/n ALY-6520R		
Sheldon A I	Burgess A&P 21	59379 She 	lelin a	Burgen		
				SUB-TOTALS this page		
			-	TOTALS-Carry forward to next page		

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
-100	r			TOTALS brought forward from previous page
		Q	AERO J	ACKSON Q
			JACKSON, MISSI	SSIPPI
	N776GA L	t Engine Date	≎ 12-17-2012	Hobbs 540.2 Total Time 3697.9 TSO 44.3
	strainer cleane	d. Stop drilled cr	acks in muffler s	/80 (4) 77/80. Changed oil and filter. Inspected oil filter. ceroshell W100 oil. Cleaned and gapped sparkplugs. Fuel shroud. Replaced cabin heat duct. Replaced # 2&4 EGT op drilled cracks in airbox. Magneto timing checked. Engine washed and ground ran. Operational checks OK. No
	I certify that this to be in airwort	s engine has beer	inspected in ac	cordance with an ANNUAL inspection and was determined
	Sheldon A Bu	ny condition. irgess A&P 2159	9379 IA <i>S</i>	elelen a Burger
I		1	. 1	
				,
			•	
	·			
	·			
	· -			
	A CONTRACTOR OF THE PARTY OF TH		000	TOTAL
. 1	i .		l Sui	3-TOTALS this page